

310 Wayto Road | Schenectady, NY 12303 ● TEL: 800-283-3888 | FAX: 518-357-9636
EMAIL: moreinfo@sandellmfg.com | www.diedrichtechnologies.com

NEUTRA SOAK “A”

1. PRODUCT DATA

Date of Preparation: March 1, 2015

Product Name: Neutra Soak “A” For Acids

Producer: Diedrich Technologies, A Hohmann & Barnard Company, 310 Wayto Road, Schenectady, NY 12303

Company Contact: Mike Eglin

Telephone: 800-283-3888

24-Hour Emergency Contact: CHEMTREC 800-424-9300

This product is manufactured for Commercial/Industrial use. Not recommended for: Household use.

2 - HAZARDS IDENTIFICATION

GHS Ratings:

Skin corrosive 1A

Destruction of dermal tissue: Exposure <3 min.
Observation <1 hour, visible necrosis in at least one animal

Eye corrosive 1

Serious eye damage: Irreversible damage 21 days after exposure, Draize score: Corneal opacity >= 3, Iritis > 1.5

Carcinogen 1A

Known Human Carcinogen Based on human evidence

GHS Hazards

H314 Causes severe skin burns and eye damage

H318 Causes serious eye damage

H350 May cause cancer

GHS Precautions

P201 Obtain special instructions before use

P202 Do not handle until all safety precautions have been read and understood

P260 Do not breathe dust/fume/gas/mist/vapors/spray

P264 Wash skin thoroughly after handling

P280 Wear protective gloves/protective clothing/eye protection/face protection

P281 Use personal protective equipment as required

P310 Immediately call a POISON CENTER or doctor/physician

P321 Specific treatment (see section 4)

P363 Wash contaminated clothing before reuse

P301+P330+P331

IF SWALLOWED: Rinse mouth. Do NOT induce vomiting

P303+P361+P353

IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse skin with water/shower

P304+P340

IF INHALED: Remove victim to fresh air and keep at rest in a position comfortable for breathing

P305+P351+P338

IF IN EYES: Rinse continuously with water for several minutes. Remove contact lenses if present and easy to do – continue rinsing

P308+P313

IF exposed or concerned: Get medical advice/attention

P405 Store locked up

P501 Dispose of contents/container according to local regulations

Danger



3. COMPOSITION

Chemical Name/ CAS No.	OSHA Exposure Limits	ACGIH Exposure Limits	Other Exposure Limits
Calcium hydroxide 1305-62-0 39 percent	15mg/m ³ TWA (total dust); 5mg/m ³ TWA (respirable fraction)	5 mg/m ³ TWA	NIOSH: 5mg/m ³ TWA
Silica, amorphous 7631-86-9 14 percent			NIOSH: 6mg/m ³ TWA
Quartz 14808-60-7 0.4 percent		0.025mg/m ³ TWA (respirable fraction)	NIOSH: 0.05mg/m ³ TWA (respirable dust)

310 Wayto Road | Schenectady, NY 12303 ● TEL: 800-283-3888 | FAX: 518-357-9636
 EMAIL: moreinfo@sandellmfg.com | www.diedrichtechnologies.com

4. FIRST AID MEASURES

Inhalation: Remove from further exposure. For those providing assistance, avoid exposure to yourself. Use adequate respiratory protection. If respiratory irritation, dizziness, nausea, or unconsciousness occurs, seek immediate medical assistance. If breathing has stopped, a trained individual should attempt to resuscitate while getting immediate medical aid.

Eye Contact: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing for 15 minutes.

Skin Contact: In case of skin contact, remove contaminated clothing. Flush the skin with large amounts of water, then wash the skin with soap and water.

Ingestion: If conscious, give 2 to 3 glasses of water. Do not induce vomiting and seek medical attention immediately.

Notes to Physician: No data found.

5. FIRE FIGHTING MEASURES

Flammable Limits: LEL: N/A UEL: N/A

Flash Point: No data available.

Extinguishing Media: Use extinguishing agent suitable for type of surrounding fire.

Unusual Fire or Explosion Hazards: No data available.

Hazardous Combustion Products: See Section 10 for a list of hazardous decomposition products for this mixture.

Fire Fighting: If evacuation of personnel is necessary, evacuate to an upwind area. Decontaminate personnel and equipment with a water wash-down after fire and smoke exposure.

Fire Fighting: Fire fighters should wear complete protective clothing including self-contained breathing apparatus.

6. ACCIDENTAL RELEASE MEASURES

Isolate the area and contain the spilled material. Persons not wearing the appropriate PPE should be removed from the area until the spill is cleaned up. Stop leak if you can do it without risk, stay upwind, and avoid run off to waterways and sewers.

SMALL SPILLS: Prevent entry into waterways, sewers, basements or confined areas. Carefully shovel or sweep up spilled material and place in suitable container, avoid generating dust .

LARGE SPILLS: Prevent entry into waterways, sewers, basements or confined areas. Carefully shovel or sweep

up spilled material and place in suitable container, avoid generating dust .

BASE SPILLS: Neutralize with Citric Acid, or Dilute Acetic Acid. Cautiously neutralize remainder. Then wash away with plenty of water.

7. HANDLING AND STORAGE

Handling Precautions: Wear all appropriate Personal Protective Equipment (PPE). Wear respiratory protection or ensure adequate ventilation at all times as vapors can accumulate in confined or poorly ventilated areas. Use the product in a manner which minimizes splashes and/or the creation of dust. Keep containment closed when not in use. Do not handle or store material near heat, sparks, or open flames, or other sources of ignition.

Storage: Prevent from freezing. Store at room temperatures, i.e., 40° to 95°F (4° to 35°C)

Regulatory Requirements: No data found

8. EXPOSURE CONTROL AND PERSONAL PROTECTION

Chemical Name/ CAS No.	OSHA Exposure Limits	ACGIH Exposure Limits	Other Exposure Limits
Calcium hydroxide 1305-62-0	15 mg/m ³ TWA (total dust); 5mg/m ³ TWA (respirable fraction)	5mg/m ³ TWA	NIOSH: 5 mg/m ³ TWA
Silica, amorphous 7631-86-9			NIOSH: 6mg/m ³ TWA
Quartz 14808-60-7		0.025mg/m ³ TWA (respirable fraction)	NIOSH: 0.05 mg/m ³ TWA (respirable dust)

Engineering controls: Avoid contact with skin, eyes and clothing. Wash hands before breaks and immediately after handling the product. Ensure that eyewash stations and safety showers are close to the workstation location.

Ventilation Control: Provide adequate ventilation to control airborne concentration below the exposure guidelines/limits.

Administrative controls: No data found.

Personal Protection: As prescribed in the OSHA Standard for Personal Protective Equipment (29 CFR 1910.132), employers must perform a hazard Assessment of all workplaces to determine the need for proper protective equipment for each employee.

310 Wayto Road | Schenectady, NY 12303 ● TEL: 800-283-3888 | FAX: 518-357-9636
 EMAIL: moreinfo@sandellmfg.com | www.diedrichtechnologies.com

Eye Protection: Normal industrial eye protection practices should be employed.

Skin Protection: In accordance with good industrial hygiene practices, precautions should be taken to avoid skin contact.

Respiratory: If airborne concentration limits are not met, an approved respirator must be worn.

Contaminated Equipment: Dispose of the waste in compliance with federal, state, regional, and local regulations.

9. PHYSICAL AND CHEMICAL PROPERTIES

Melting point: Not Determined
Freezing point: Not Determined
Solubility: Complete
Boiling range: 2230°C
Flash point: 999°C, 999°F
Evaporation rate: Not Determined
Flammability: Not Determined
Appearance: Gray Powder
Odor: Odorless
Physical State: Liquid
Vapor Pressure: Not Determined
Odor threshold: Not Determined
Vapor Density: Not Determined
Explosive Limits: 0%
Partition coefficient (n-Octanol/water): Not Determined
Autoignition temperature: N/A
Decomposition temperature: Not Determined
Viscosity: Not Determined
Density: 1.109545447

10. STABILITY AND REACTIVITY

Stability: STABLE
Incompatibilities: No data found.
Hazardous Decomposition Products: *Note:* these are all possible decomposition products based on molecular structure of components.
 – No data found.
 – Hazardous polymerization will not occur.

11. TOXICOLOGICAL INFORMATION

Mixture Toxicity: No data found.
Component Toxicity: No data found.
Routes of entry: No data found.
Target Organs: Eyes, Skin, and Respiratory System
Effects of Overexposure: No data found.

CAS Number	Description	% Weight	Carcinogen Rating
14808-60-7	Quartz	0.4	Quartz: NIOSH: potential occupational carcinogen IARC: Human carcinogen OSHA: listed

12. ECOLOGICAL INFORMATION

Ecotoxicity: No data available for this product.
Component Ecotoxicity: Silica, amorphous
 96 Hr LC50 Brachydanio rerio: 5000 mg/L [static]
 48 Hr EC50 Ceriodaphnia dubia: 7600 mg/L
 72 Hr EC50 Pseudokirchneriella subcapitata: 440 mg/L

13. DISPOSAL

Disposal Instructions: Refer to the latest federal, state, and local regulations regarding proper disposal.

14. TRANSPORTATION INFORMATION

The following is for US DOT Highway transportation. Other modes/jurisdictions may have different classifications.

Agency	Proper Shipping Name	UN Number	Packaging Group	Hazard Class
US DOT	NON-REGULATED			

15 - REGULATORY INFORMATION

This listing is to highlight federal level regulation of the product. Individual states, and other nations may have further regulations not listed below.

US DOT List of Marine Pollutants (172.101 - Appendix B): None
US DOT List of Hazardous Substances and Reportable Quantities (172.101 Appendix A): None
US DOT List of Severe Marine Pollutants (172.101 - Appendix B): None
SARA Section 302 Extremely Hazardous Substances (40 CFR 355): None
Sara Section 302 Threshold Planning Quantity: None
SARA Section 313, Toxic Chemicals (40 CFR 372.65): None
SARA Reportable Quantity: None

310 Wayto Road | Schenectady, NY 12303 ● TEL: 800-283-3888 | FAX: 518-357-9636
EMAIL: moreinfo@sandellmfg.com | www.diedrichtechnologies.com

EU RISK PHRASES

Toxic Substances Control Act (TSCA): All components are listed or exempt from the Toxic Substances Control Act except those listed below.

- None


Section 313 of Title III of the Superfund Amendments and Reauthorization Act of 1985 (SARA). This product contains a chemical or chemicals which are subject to the reporting requirements of the Act, and Title 40 of the Code of Federal Regulations, part 372.

16. OTHER INFORMATION

Hazardous Material Information System (HMIS)

Health	1
Flammability	0
Physical Hazard	0
Personal Protection	C

National Fire Protection Association (NFPA)

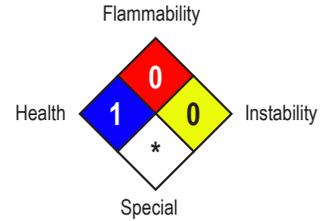

HMIS & NFPA Hazard Rating Legend

- * = CHRONIC HEALTH HAZARD
- 0 = INSIGNIFICANT
- 1 = SLIGHT
- 2 = MODERATE
- 3 = HIGH

LEGEND

0 = LEAST 1 = SLIGHT 2 = MODERATE 3 = HIGH 4 = EXTREME

N.D. = NOT DETERMINED N.A. = NOT AVAILABLE N/A = NOT APPLICABLE

DISCLAIMER: While this company believes that the data contained herein are factual and the opinions expressed are based on tests and data believed to be reliable, it is the user's responsibility to determine the safety, toxicity and suitability for his own use of the product described herein. Since the actual use by others is beyond our control, no guarantee, expressed or implied, is made by this company as to the effects of such use, the results to be obtained, or the safety and toxicity of the product, nor does this company assume any liability arising out of use, by others, of the product referred to herein. Nor is this information herein to be construed as absolutely complete since additional information may be necessary or desirable when particular or exceptional conditions or circumstances exist or because of applicable laws or governmental regulations.

REQUIRED SUPPLEMENTAL CONTRACT TERMS: Failure to obtain a property owner's written acceptance of the enclosed Required Supplemental Terms and Conditions for Restoration Contract shall release any and all of the manufacturer's express or implied warranties (including, without limitation, merchantability and fitness for particular purpose) and user shall indemnify and hold manufacturer harmless from all liability cost and expenses arising in any way from use of or contact with this product. All claims of any kind against manufacturer arising from or related to this product in any way shall be decided by binding arbitration in accordance with the Construction Industry Arbitration Rules of the American Arbitration Association.

Copyright © 2015

Diedrich Technologies is a division of



Hohmann & Barnard, Inc.
30 Rasons Court | Hauppauge, NY 11788
TEL: 800-645-0616 | FAX: 631-234-0683
EMAIL: weanchor@h-b.com | www.h-b.com